HOME REPORT

108 FORBESHILL FORRES IV36 1JL



ENERGY PERFORMANCE CERTIFICATE



Energy Performance Certificate (EPC)

Dwellings

Scotland

108 FORBESHILL, FORRES, IV36 1JL

Dwelling type: Detached house
Date of assessment: 24 February 2025
Date of certificate: 27 February 2025

Total floor area: 110 m²

Primary Energy Indicator: 238 kWh/m²/year

Reference number: 0715-2722-4000-0524-6222 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£4,242	See your recommendations
Over 3 years you could save*	£1,011	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

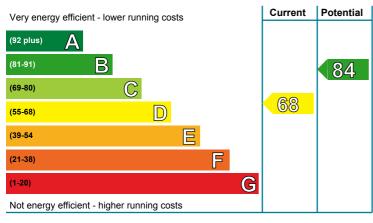


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (68)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

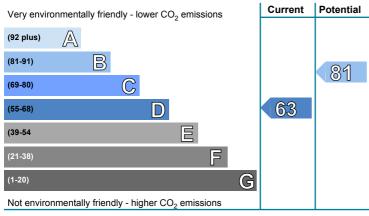

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (63)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£384.00
2 Floor insulation (suspended floor)	£800 - £1,200	£390.00
3 Low energy lighting	£25	£114.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, partial insulation (assumed) Timber frame, as built, insulated (assumed)	★★★☆☆ ★★★★☆	★★★☆☆ ★★★★☆
Roof	Pitched, insulated (assumed) Pitched, 250 mm loft insulation	★★★☆☆ ★★★★☆	★★★☆☆ ★★★★☆
Floor	Suspended, no insulation (assumed) (another dwelling below)	_ _	_ _
Windows	Partial double glazing	***	***
Main heating	Boiler and radiators, mains gas	****	★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	****	★★★ ☆
Secondary heating	Room heaters, mains gas	_	_
Hot water	From main system	****	★★★ ☆
Lighting	Low energy lighting in 58% of fixed outlets	★★★★ ☆	★★★ ☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 42 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.1 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£3,441 over 3 years	£2,688 over 3 years	
Hot water	£354 over 3 years	£228 over 3 years	You could
Lighting	£447 over 3 years	£315 over 3 years	save £1,011
Total	s £4,242	£3,231	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


December ded massives		Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	nded measures Indicative cost		Energy	Environment
1	Cavity wall insulation	£500 - £1,500	£128	C 71	D 67
2	Floor insulation (suspended floor)	£800 - £1,200	£130	C 73	C 71
3	Low energy lighting for all fixed outlets	£25	£38	C 74	C 71
4	Solar water heating	£4,000 - £6,000	£42	C 75	C 73
5	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£397	B 84	B 81

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

External insulation with cavity wall insulation

Choosing the right improvement package

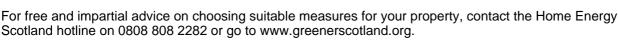



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	14,860	(73)	(1,912)	N/A
Water heating (kWh per year)	1,845			

Addendum

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. David Cruickshank

Assessor membership number: EES/012072

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: 27 High Street

Toryglen Elgin IV30 1EE

Phone number: 0131 6246160

Email address: david.cruickshank@dmhall.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY



survey report on:

Property address	108 FORBESHILL, FORRES, IV36 1JL	
Customer	MRS PATRICIA MORRISON'S EXECUTRY	
Customer address	C/O A PRINGLE & I MILLER, R&R URQUHART, 117-121 HIGH STREET, FORRES, IV36 1AB	
Prepared by	DM Hall LLP	
Date of inspection	24th February 2025	



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	A detached house.	
Accommodation	Ground floor: vestibule, hall, living room, bedroom kitchen/dining room and shower room/W.C.	
	Upper floor two bedrooms and bathroom/W.C.	
Gross internal floor area (m²)	Approximately 110.	
Neighbourhood and location	The property forms part of an established residential area in the town of Forres. The surrounding properties in the immediate vicinity are generally of a similar age and style. A range of typical local amenities can be found within the town.	
Age	Built circa 1975.	
Weather	It was dry and sunny after a predominantly dry period of weather.	
Chimney stacks	There are no chimney stacks.	
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.	
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.	
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.	
	The roof is pitched and clad with interlocking concrete tiles.	
	The roof space was accessed through a hatch in the landing ceiling where a 'head and shoulders' inspection was carried out. The roof is timber framed with fibreboard sarking boards and assumed	

Roofing including roof space	under felt beneath the tiles. Glasswool insulation has been laid between and over the ceiling joists.	
	There are two redundant plastic cold water tanks.	
	The roof over the ground floor shower room and entrance vestibule is pitched and clad with interlocking concrete tiles.	
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.	
	There are half round gutters and round downpipes in PVC.	
Main walls	Visually inspected with the aid of binoculars where appropriate.	
	Foundations and concealed parts were not exposed or inspected.	
	The ground floor external walls are mainly of cavity concrete block construction, rendered externally. The upper floor external walls are timber framed and timber clad.	
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.	
	Random windows were opened and closed where possible.	
	Doors and windows were not forced open.	
	Windows are mainly uPVC framed double glazed casements. There is a wooden single glazed Velux roof light at the upper floor level.	
	The front door is a uPVC. There is a single glazed wooden rear door with single glazed side window, it provides access to an attached greenhouse.	
	Fascias and soffits at the eaves are lined in uPVC.	
External decorations	Visually inspected.	
	Woodwork has a painted finish.	
Conservatories / porches	There are no conservatories or porches.	
Communal areas	There are no communal areas.	
Garages and permanent outbuildings	Visually inspected.	
	There is an integral single garage, construction matches the main build of the house. It has a metal up and over car door at the front.	

Outside areas and boundaries	Visually inspected.	
	The house is bounded by private garden areas at the front and rear. There are paved paths at the sides. Gardens are mainly laid out to lawn and flower borders. A paved drive provides access to the garage. Boundaries are mainly defined by wooden fences with the public street at the front.	
Ceilings	Visually inspected from floor level.	
	Ceilings are mainly lined with plasterboard. There are some pine panelled finishes.	
Internal walls	Visually inspected from floor level.	
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.	
	Internal walls are timber stud partitions with a plasterboard finish. There are some pine panelled finishes.	
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.	
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.	
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.	
	Flooring throughout the house is a suspended timber which is overlaid with tongue and groove boarding or an equivalent material.	
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.	
	Kitchen units were visually inspected excluding appliances.	
	The kitchen is fitted with a range of laminated cabinets and worktops.	
	Internal doors are a mixture of wooden glazed or panelled doors and others are of a hollow core and design with a painted finish.	
	There is a wooden staircase with handrails.	
	The front bedroom at the upper floor level has a built-in wardrobe.	

Joinery finishes are in softwood.

Chimney breasts and fireplaces	Visually inspected.	
	No testing of the flues or fittings was carried out.	
	There is a gas fire in the living room. It has a balanced flue.	
Internal decorations	Visually inspected.	
	Walls and ceilings are mainly painted, papered or pine panelled. There tiled finishes in the bathroom.	
Cellars	There are no cellars.	
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.	
	There is a mains electricity supply. The meter is located within an external box, the fuse boxes are located in a cupboard accessed from the hall. Wiring, where visible is PVC sheathed and 13 amp sockets have been installed throughout the property.	
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.	
	Mains gas supply installed. The meter is located in the garage.	
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.	
	No tests whatsoever were carried out to the system or appliances.	
	There is a mains water supply. There is a stainless steel sink in the kitchen and plumbing, where visible is in copper and plastic. The stop cock to isolate the mains water supply would appear to be located below the kitchen sink.	
	The shower room at the ground floor level has three white fittings with a wall mounted electric shower in the shower compartment.	
	The bathroom at the upper floor level has three coloured fittings	

with a wall mounted electric shower over the bath.

Heating and hot water

Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.

No tests whatsoever were carried out to the system or appliances.

There is gas central heating working from a wall mounted 'Ideal' combination boiler which is located in the garage. The boiler provides instantaneous hot water as well as central heating via steel panelled radiators which are distributed throughout the property.

The central heating system is controlled using a programmer in the kitchen, a thermostat in the hall and wall mounted thermostatic radiator valves.

There is a gas fire in the living room as an alternative source of heat.

Drainage

Drainage covers etc were not lifted.

Neither drains nor drainage systems were tested.

Drainage is connected to the main sewer.

Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

Smoke detectors are mounted on the living room, hall and landing ceilings, with a heat detector on the kitchen ceiling.

There is a burglar alarm system installed.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

The property was unoccupied, but furnished and floors were covered. Furnishings, floor coverings and personal effects have not been moved. The sub-floor area was not accessed due to the lack of a suitable hatch. Floor coverings have not been moved. The back door was not operated due to the lack of a key.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have

Any additional limits to inspection

assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.


Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

Sectional Diagram showing elements of a typical house

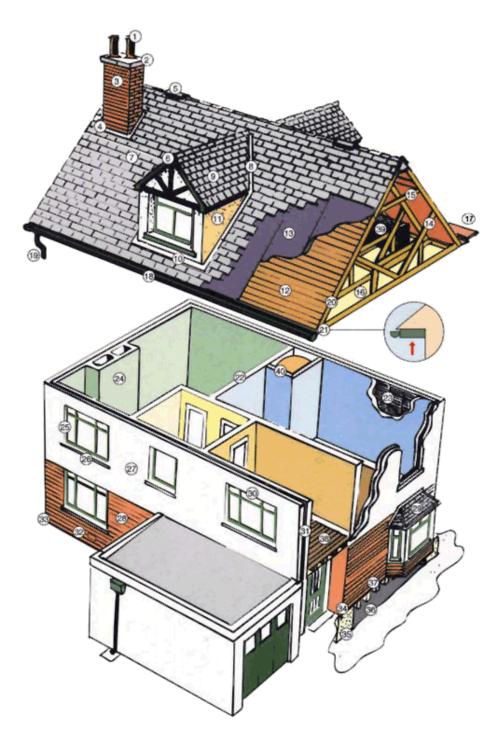

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- 16 Insulation
- Parapet gutter
- 18 Eaves guttering
- 19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
- 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29 Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- 34) Base course
- 35) Foundations
- (36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40 Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, rot and infestation	
Repair category	1
Notes	No obvious evidence of significant dampness, rot or wood boring insect infestation.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	2
Notes	There is fairly extensive moss growth. There is some cracking at the verges which will require repair. Concrete tiles are typically guaranteed for 30 years but have a reasonable life
	expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair or replacement costs.

Rainwater fittings	
Repair category	2
Notes	There is a broken downpipe joint at the rear of the house.

Main walls	
Repair category	2
Notes	There is some hairline cracking in places. Some cracking has been infilled using silicone.
	Timber cladding exhibits some weathering, close up inspection may reveal some patched decay.

Windows, external doors and joinery	
Repair category	2
Notes	The Velux window lacks an internal pane of glass. It is affected by patched decay. Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fitments are functional. There is a degree of general wear and tear to the window installation consistent with its age and use. It should be appreciated that double glazed replacement windows can be problematic and over time. The operations can be affected and the opening mechanisms damaged. Ongoing maintenance should be anticipated. Double glazed window seals can often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions.

External decorations	
Repair category	2
Notes	Outside paintwork has deteriorated and redecoration is now required. Regular repainting of external joinery finishes will prolong their life span.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	1
Notes	No significant defects evident.

Outside areas and boundaries	
Repair category	1
Notes	No significant defects evident.

Ceilings	
Repair category	1
Notes	No significant defects evident.

Internal walls	
Repair category	1
Notes	No significant defects evident.

Floors including sub-floors	
Repair category	1
Notes	No significant defects evident.

Floors including sub-floors	
Repair category	1
Notes	It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings	
Repair category	2
Notes	Fitted kitchen units are dated. An incoming occupier can upgrade/replace to their own personal taste. The glazed internal doors may not be fitted with safety glass.

Chimney breasts and fireplaces	
Repair category	2
Notes	The gas fire is an older variety. The gas industry suggests that gas fires should be serviced annually to ensure safe combustion.

Internal decorations	
Repair category	2
Notes	Some decorations are dated or worn in places.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	The electrical installation appears to be of a mixed age, some older components remain in place. An NICEIC/SELECT registered electrician can be engaged to examine the system and implement all necessary upgrading works. It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	1
Notes	No significant defects evident.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	No significant defects evident.

Heating and hot water	
Repair category	2
Notes	It is assumed that the heating and hot water systems have been installed in accordance with all relevant regulations and thereafter maintained on a regular basis.
	It is common practice for purchasers to have systems checked by an engineer immediately upon taking ownership, as stated in most offers to purchase used by conveyancers.
	The radiators and pipework are of an older style.

Drainage	
Repair category	1
Notes	No significant defects noted.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	2
Internal decorations	2
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor.
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The valuation is inclusive of a roughly rectangular area of garden ground which bounds the house on all sides, this should be confirmed from the title.

The house has been extended at one side to create the ground floor shower room. Works are known to be historic in nature.

Estimated reinstatement cost for insurance purposes

£320,000 (Three Hundred And Twenty Thousand Pounds).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments

£185,000 (One Hundred And Eighty Five Thousand Pounds).

Against a backdrop of changing economic circumstances and increased interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

Signed	Security Print Code [343449 = 9114] Electronically signed
Report author	DAVID CRUICKSHANK
Company name	DM Hall LLP
Address	27 High Street, Elgin, IV30 1EE
Date of report	4th April 2025



Property Address					
Address Seller's Name Date of Inspection	108 FORBESHILL, FORRES, IV36 1JL MRS PATRICIA MORRISON'S EXECUTRY 24th February 2025				
Property Details					
Property Type	X House Bungalow Chalet Purpose built maisonette Coach Studio Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)				
Property Style	X Detached Semi detached Mid terrace End terrace Back to back High rise block Low rise block Other (specify in General Remarks)				
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, Yes X No nilitary, police?				
Flats/Maisonettes onl					
Approximate Year of					
Tenure					
X Absolute Ownership	Leasehold Ground rent £ Unexpired years				
Accommodation					
Number of Rooms	1 Living room(s) 3 Bedroom(s) 1 Kitchen(s) 2 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)				
Gross Floor Area (exc	cluding garages and outbuildings) 110 m² (Internal) m² (External)				
Residential Element ((greater than 40%) X Yes No				
Garage / Parking /	Outbuildings				
X Single garage Available on site?	□ Double garage □ Parking space □ No garage / garage space / parking space ▼ Yes □ No				
Permanent outbuildings:					
None.					

Construction							
Walls	X Brick	Stone	Concrete	X Timber frame			
	Solid	X Cavity	Steel frame		Other	(specify in Gen	eral Remarks)
Roof	X Tile	Slate	Asphalt	Felt		(,
	Lead	Zinc	Artificial sla		Other	(specify in Gen	eral Remarks)
	_	<u>—</u>	<u>—</u>				·
Special Risks							
Has the property	suffered struct	ural movemer	nt?			Yes	X No
If Yes, is this rece	ent or progress	ive?				Yes	No
Is there evidence, immediate vicinity	history, or rear?	ison to anticip	ate subsidence	heave, landslip o	r flood in the	Yes	X No
If Yes to any of th	e above, provi	de details in C	Seneral Remark	S.			
Service Connec	ction						
		If any consist	oc appear to be	non maine places	o comment a	on the time of	ad location
Based on visual ir of the supply in G			es appear to be	non-mains, piease	e comment o	iii tile type al	iu iocation
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description of	of Central Heat	ing:					
Gas fired boiler	to radiators.						
Site							
Apparent legal iss	ruos to bo vorit	ind by the cor	wovencor Plea	co provido a briof	doceription i	n Gonoral P	omarke
Rights of way	Shared drive		_	amenities on separate	_	ed service conr	
Agricultural land in		_	Ill-defined bound			r (specify in Ge	
	р. оро	,		aec		(оросп) п. Ос	
Location							
Residential suburb	X Resi	dential within tow	n / city Mixe	d residential / commer	cial Main	ly commercial	
Commuter village	Rem	ote village	Isola	ted rural property	Othe	r (specify in Ge	neral Remarks)
Planning Issues	6						
Has the property I	been extended	/ converted /	altered? X	∕es No			
If Yes provide details in General Remarks.							
•							
Roads							
Made up road	Unmade road	Partly c	ompleted new road	Pedestrian a	ccess only	X Adopted	Unadopted

Some works of repair and maintenance are required and a degree of modernisation would be beneficial. The valuation is inclusive of a roughly rectangular area of garden ground which bounds the house on all sides, this should be confirmed from the title. The house has been extended at one side to create the ground floor shower room. Works are known to be historic in nature.
Essential Repairs
None.

Comment on Mortgageability					
The property is considered lender.	d suitable for mortgage purposes subject, as always, to the policy of the in	ndividual			
Valuations					
Market value in present condition Market value on completion of essential repairs Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary?					
Buy To Let Cases					
What is the reasonable range of monthly rental income for the property assuming a letting on a 6 M/a month Short Assured Tenancy basis?					
Is the property in an area w	here there is a steady demand for rented accommodation of this type?	Yes No			
Declaration					
Signed Surveyor's name Professional qualifications Company name Address	Security Print Code [343449 = 9114] Electronically signed by:- DAVID CRUICKSHANK MRICS DM Hall LLP 27 High Street, Elgin, IV30 1EE				
Telephone Fax	01343 548501 01343 540170				

Report date

4th April 2025

PROPERTY QUESTIONNAIRE





Property Questionnaire

PROPERTY ADDRESS:	108 Forbeshill, Forres, Moray IV36 1JL	

SELLER(S):	Anne Pringle Irene Miller	

COMPLETION DATE OF PROPERTY QUESTIONNAIRE: 18/03/2025

PROPERTY QUESTIONNAIRE

NOTE FOR SELLERS

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.

PROPERTY QUESTIONNAIRE Information to be given to prospective buyer(s)

1. Length of ownership

How long have you owned the property?

Approx. 31 years

2. Council Tax

Which Council Tax band is your property in?

3. Parking

What are the arrangements for parking at your property?

(Please indicate all that apply)

- Garage YES
- Allocated parking space
- Driveway YES
- Shared parking
- On street YES
- Resident permit
- Metered parking
- Other (please specify):

4.	Conservation Area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	No
5.	Listed Buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations / additions / extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	No
	If you have answered yes, please describe the changes which you have made:	

	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?					
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.					
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.					
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?					
	If you have answered yes, please answer the three questions below:					
	(i) Were the replacements the same shape and type as the ones you replaced?					
	(ii) Did this work involve any changes to the window or door openings?					
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):	n/a				
	Please give any guarantees which you received for this work to your solicitor or estate agent.	n/a				

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).	Yes
	If you have answered yes/partial – what kind of central heating is there?	
	(Examples: gas-fired, solid fuel, electric storage heating, gas warm air.)	
	Gas-fired	
	If you have answered yes, please answer the 3 questions below:	
b.	When was your central heating system or partial central heating system installed?	
	Prior to house purchase	
c.	Do you have a maintenance contract for the central heating system?	
	If you have answered yes, please give details of the company with which you have a maintenance agreement:	
	unsure	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
	Don't know	

8.	Energy Performance Certificate					
	Does your property have an Energy Performance Certificate which is less than 10 years old?					
9.	Issues that may have affected your property					
a.	Has there been any sto damage to your prope	orm, flood, fire rty while you h	or other structural ave owned it?	No		
	If you have answered any outstanding insur	<u>yes,</u> is the dam ance claim?	age the subject of	Yes/No n/a		
b.	Are you aware of the eproperty?	existence of asl	oestos in your	Yes/No n/a		
40	If you have answered	yes , piedes giv				
10.	Services					
a.	Please tick which serve property and give details	vices are conne ails of the supp	ected to your blier:			
	Services	Connected	Supplier			
	Gas / liquid petroleum gas	YES	British Gas			
	Water mains / private water supply	YES	-			
	Electricity	YES	OVO			

		VEC		
-	Mains drainage	YES	-	,
	Telephone	YES	ВТ	
	Cable TV / satellite	NO		
	Broadband	NO		
b.	Is there a septic tank	system at you	r property?	No
200	If you have answered questions below:	<u>l yes,</u> please an	swer the two	
c.	Do you have appro from your septic tanl	priate consent k?	s for the discharge	Yes/No/ Don't Know <mark>n/a</mark>
d.	Do you have a mai tank?	ntenance conti	ract for your septic	Yes/No <mark>n/a</mark>
	If you have answer company with which	<u>ed yes,</u> please you have a ma	give details of the intenance contract:	

4.4	D	
11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	No
	If you have answered yes, please give details:	90.
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	No
	If you have answered yes, please give details:	
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	No
	If you have answered yes, please give details:	,
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	No
	If you have answered yes, please give details:	

f.	As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:	No
b.	Is there a common buildings insurance policy?	No
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes/No/ Don't know <mark>n/a</mark>
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.	

13.	Specialist Works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property	No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	No
	If you have answered yes, please give details	
c.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	

						1	
	Guarantees are held by:						
					85		
		6					
					0		
						1.	
						15 II.	
14.	Guarantees						
a.	Are there any guarantees	or wa	arrant	ies for any	y of the		
	following:					[
(i)	Electrical work	No	Yes	Don't	With tit		Lost
			.,	Know	deeds		1 4
(ii)	Roofing	No	Yes	Don't	With tit		Lost
/····	Control booting	Ma	Vac	Know Don't	deeds With tit		Lost
(iii)	Central heating	No	Yes	know	deeds		LUST
(iv)	NHBC	No	Yes	Don't	With tit		Lost
(10)	NIBO	140	103	know	deeds		
(v)	Damp course	No	Yes	Don't	With tit		Lost
(*)	Zamp como	2 2 2		know	deeds	5	
(vi)	Any other work or	No	Yes	Don't	With tit	le	Lost
` '	installations?			know	deeds	6	
	(for example, cavity wall						
	insulation,	-					
	underpinning, indemnity						
	policy)						
	If you have anamous of tree	n) n = 6	isarith 4	itla daada	' nloses a	iivo 4	dotaile
b.	If you have answered 'yes of the work or installation	s or	which	the quara	, piease g	late/	e).
	of the work of installation	ເວ ເປ ່	WILL	uie guara	11166(3) 16	iare(<i>J</i> ₁ .

c.	Are there any outstanding claims under any of the guarantees listed above?	Yes/No
	If you have answered yes, please give details:	
	no	
ζ.		
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	No
	If you have answered yes, please give details:	
16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	No
b. c.	that affects your property in some other way? that requires you to do any maintenance, repairs or improvements to your property?	No No
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.	

Declaration by the seller(s)/or other authorised body or person(s):				
I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.				
Signature(s) :				
Anne F Pringle via email				
Date:18/03/2025				



ABERDEEN

aberdeen_residential@dmhall.co.uk01224 594172

AYR

ayr@dmhall.co.uk 01292 286974

DUMFRIES

dumfries@dmhall.co.uk 01387 254318

DUNDEE

dundee@dmhall.co.uk 01382 873100

DUNFERMLINE

dunfermline@dmhall.co.uk 01383 621262

EDINBURGH

edinburghresidential@dmhall.co.uk 0131 624 6600

FLGIN

elgin@dmhall.co.uk 01343 548501

FALKIRK

falkirk@dmhall.co.uk 01324 628321

GALASHIELS

galashiels@dmhall.co.uk 01896 752009

GLASGOW (Residential)

glasgowresidential@dmhall.co.uk 0141 636 4141

HAMILTON

hamilton@dmhall.co.uk 01698 284939

INVERNESS

inverness@dmhall.co.uk 01463 241077

INVERURIE

inverurie@dmhall.co.uk 01467 624393

IRVINE

irvine@dmhall.co.uk 01294 311070

KIRKCALDY

kirkcaldy@dmhall.co.uk 01592 598200

LIVINGSTON

livingston@dmhall.co.uk 01506 490404

OBAN

oban-admin@dmhall. co.uk 01631 564225

PAISLEY

Enquiries are now dealt with at our Glasgow Hub.

PERTH

perth@dmhall.co.uk 01738 562100

PETERHEAD

peterhead@dmhall.co.uk 01779 470220

ST ANDREWS

standrews@dmhall.co.uk 01334 844826

STIRLING

stirling@dmhall.co.uk 01786 475785

