HOME REPORT

1 MARKET STREET FORRES IV36 1EF



ENERGY PERFORMANCE CERTIFICATE



Energy Performance Certificate (EPC)

Dwellings

Scotland

1 MARKET STREET, FORRES, IV36 1EF

Dwelling type: Detached house
Date of assessment: 15 June 2022
Date of certificate: 23 June 2022
Total floor area: 111 m²

Primary Energy Indicator: 345 kWh/m²/year

Reference number:
Type of assessment:
Approved Organisation:
Main heating and fuel:

0130-2145-6060-2792-0541 RdSAP, existing dwelling

Elmhurst

Boiler and radiators, mains


gas

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£4,086	See your recommendations
Over 3 years you could save*	£1,884	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

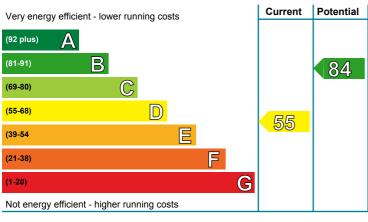


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (55)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

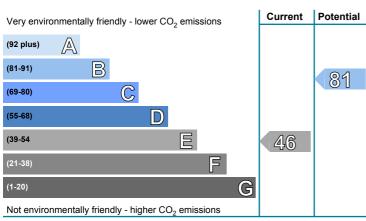

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (46)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£1,500 - £2,700	£936.00
2 Internal or external wall insulation	£4,000 - £14,000	£522.00
3 Floor insulation (solid floor)	£4,000 - £6,000	£207.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	***	***
	Cavity wall, as built, partial insulation (assumed)	$\star\star\star$	★★★☆☆
Roof	Pitched, 270 mm loft insulation Roof room(s), no insulation (assumed)	**** ***	**** ****
Floor	Solid, no insulation (assumed) Suspended, no insulation (assumed)		_ _ _
Windows	Fully double glazed	***	***
Main heating	Boiler and radiators, mains gas	****	★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	****	★★★ ☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	_	_
Hot water	From main system	****	****
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 62 kg $CO_2/m^2/yr$.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 6.9 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£3,546 over 3 years	£1,740 over 3 years	
Hot water	£285 over 3 years	£207 over 3 years	You could
Lighting	£255 over 3 years	£255 over 3 years	save £1,884
Totals	£4,086	£2,202	over 3 years


These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December de discourse		Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	indicative cost	per year	Energy	Environment
1	Room-in-roof insulation	£1,500 - £2,700	£312	D 65	D 59
2	Internal or external wall insulation	£4,000 - £14,000	£174	C 71	D 67
3	Floor insulation (solid floor)	£4,000 - £6,000	£69	C 73	C 70
4	Solar water heating	£4,000 - £6,000	£27	C 74	C 72
5	Replacement glazing units	£1,000 - £1,400	£46	C 76	C 74
6	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£319	B 84	B 81

Choosing the right improvement package





About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

3 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	23,869	N/A	(444)	(3,544)
Water heating (kWh per year)	2,271			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Michael McDonald

Assessor membership number: EES/009379

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: 27 High Street

Toryglen Elgin IV30 1EE

Phone number: 1V30 1EE 01343 548501

Email address: michael.mcdonald@dmhall.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY



survey report on:

Property address	1 MARKET STREET FORRES IV36 1EF	
Customer	Mr Douglas and Mrs Brenda Urquhart	
Customer address	26 Conon Crescent Elgin IV30 1FZ	
Prepared by	DM Hall LLP	
Date of inspection	15th June 2022	



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report ² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The property is a one and a half storey detached cottage.
Accommodation	Ground: Entrance Vestibule, Hallway, Living Room, Dining Room, Two Bedrooms and Kitchen. First: Bedroom and Bathroom.
Gross internal floor area (m²)	118sq.m approximately.
Neighbourhood and location	The property forms part of an established residential area in the town of Forres. The surrounding properties in the immediate vicinity are generally of a differing age and style. A range of typical local amenities can be found nearby.
Age	122 years.
Weather	It was overcast and dry, following generally mixed weather conditions.
Chimney stacks	The chimney stacks are of stone construction, having a pointed finish. There are cement flashings at the base of the chimneys.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is of a pitched design, overlaid with natural slates. The side extension roof is of a flat design, overlaid with rubber membrane. Dormer windows are in place to the front, having a pitched roof, overlaid in natural slates. Flashings around dormers are formed in copper. Access to the roof space is available via a

	The cold and a land account of the cold and a second of the cold and a
	wall hatch in the bathroom cupboard. The roof is of timber construction, with timber sarking. There is no underside felt as an additional barrier to moisture. There are insulation materials laid over and between the ceiling joists. The eves hatches are sealed shut.
Rainwater fittings	There are half round cast iron gutters in place, which connect to round cast iron downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The property is of traditional stone wall construction. The side extension appears to be of solid block construction. The walls have a rendered and pointed external finish.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows: Double glazed, UPVC framed windows units are installed. Doors: The access doors are of UPVC double glazed design. There is a double glazed roof light window.
External decorations	The external timbers and rainwater fittings are painted. There are painted wall finishes. There is PVC panelling around the dormer.
Conservatories / porches	There are no conservatories / porches.
Communal areas	There are no communal areas.
Garages and permanent outbuildings	There are no Garages or Permanent Outbuildings.
Outside areas and boundaries	The property has a garden area to the front. The garden areas are surfaced in chip stones, paving and planting. The boundaries are formed in block walls and stone walls. There are timber and poly carbonate sheeting shelters. There is a timber and felt shed.
Ceilings	Visually inspected from floor level.
	The ceilings are of lath and plaster and plasterboard construction.


Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls and partitions are of lath and plaster, plaster on the hard and plasterboard wall construction. There are some hard board linings.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	The extension and upper floors are formed with suspended timber joists being overlaid with timber tongue and groove flooring. The ground floor is of solid construction.
Internal joinery and kitchen fittings	Kitchen units were visually inspected excluding appliances.
	The internal doors consist of flush timber and timber and glazed style. The facings and skirtings are of moulded style. The kitchen is fitted with a range of base and wall mounted units having compatible worktops. The stairs and handrail are formed in timber. There are fitted storage units in the bedroom.
Chimney breasts and fireplaces	A solid fuel burning stove is fitted in the living room. All other
	original fireplace openings have been blocked.
Internal decorations	Visually inspected.
	The internal walls and ceilings mostly have a papered and painted finish. The internal joinery finishes are finished in paint and varnish.
Cellars	There are no cellars.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Main supply installed. The electricity consumer unit and meter are
	located in the kitchen.

Gas	Mains supply installed. The gas meter is located in an external box.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. A stainless steel sink unit and side drainer are fitted within the kitchen. Water is connected to the mains. The plumbing is formed in mainly PVC and copper materials. The bathroom is fitted with a white suite containing a WC, wash hand basin and bath with mixer shower.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. A wall mounted gas fired Worcester boiler within the kitchen supplies the radiator heating system. This also supplies the domestic hot water. The central heating system is controlled by a programmer in the kitchen.
Drainage	Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested. Drainage is connected to the mains sewer.
Fire, smoke and burglar alarms	There are smoke alarms installed in the property. The Owners have advised that these comply with legislation by the Scottish Government, that took effect from February 2022, that requires residential properties to have a system of inter-linked smoke alarms, carbon monoxide detectors and heat detectors. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.
Any additional limits to inspection	Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect. I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties. The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered

with the use of a moisture meter where accessible and considered appropriate. The property was unoccupied but furnished and all floors were covered. Floor coverings restricted my inspection of flooring. In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects, particularly in

cupboards. Floor coverings have not been moved. Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection. My physical inspection of the roof void area was restricted due to insulation material, the limited size of the space and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch. My inspection of the roof covering was restricted from ground level and some parts were not visible. I was not able to inspect the sub floor area. Concealed areas beneath and around the bath were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric. The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required. Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

Sectional Diagram showing elements of a typical house

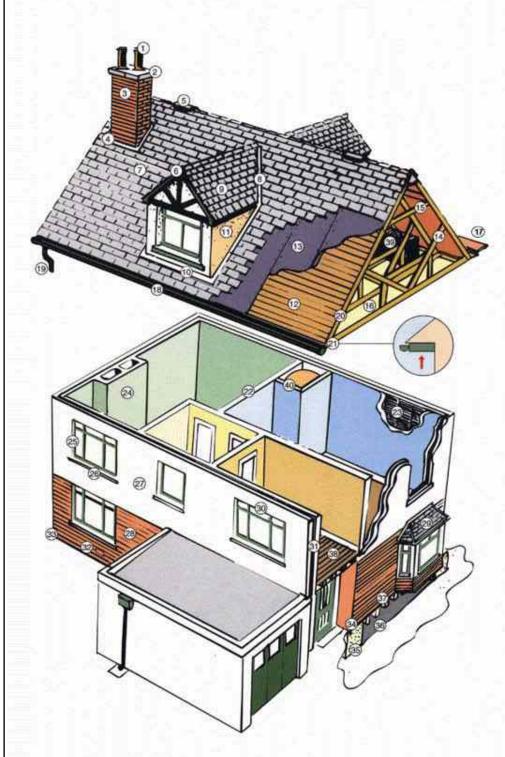

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1 Chimney pots
- 2 Coping stone
- 3) Chimney head
- 4) Flashing
- (5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9) Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 17) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 0) Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- ×
- (24) Chimney breast
- 25) Window pointing
- 26) Window sills
- (27) Rendering
- (28) Brickwork / pointing
- (29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 8) Floorboards
- 9) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movemen	nt
Repair category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, rot and infestation	
Repair category	3
Notes	There are some woodworm holes in the under stair cupboard and to roof timbers. There may be further infestation in concealed areas. The Owner advised that the under stair area has been treated in the past by themselves but there are no guarantees in place. There are some damp patches to lower walls. Further investigation can be carried out by a firm of Timber and Damp Specialists with a view to having all necessary remedial repair work implemented.

Chimney stacks	
Repair category	1
Notes	No significant defects evident.

Roofing including roof space	
Repair category	2
Notes	There is evidence of woodworm. Please see comments under Dampness, Rot & Infestation. There is some older damp staining to roof timbers. There is no under slate felt as an additional barrier to moisture. The roof is now of considerable age and is likely original. There is an unusual flashing detail on the end. Regular and ongoing maintenance should be anticipated with older roofs of this kind to ensure that they remain wind and water tight.

Rainwater fittings	
Repair category	2
Notes	There is some surface corrosion to rainwater fittings.

Main walls	
Repair category	2
Notes	There are some areas of cracked render.

Windows, external doors and joinery	
Repair category	2
Notes	There is a degree of general wear and tear to the window installation consistent with its age and use. It should be appreciated that double glazed replacement windows can be problematic and over time. The operations can be affected and the opening mechanisms damaged. Ongoing maintenance should be anticipated. Seals on double glazed windows have failed resulting in condensation build up between the panes.

External decorations	
Repair category	2
Notes	There are some areas of peeling paint.

Conservatories/porches	
Repair category	-
Notes	

Communal areas	
Repair category	-
Notes	

Garages and permanent outbuildings	
Repair category	1
Notes	No significant defects evident.

Outside areas and boundaries	
Repair category	2
Notes	No significant defects evident.

Ceilings	
Repair category	2
Notes	There is plaster cracking to ceilings. When plaster starts to pull loose from the laths the cracking often becomes widespread. Small cracks in this type of ceiling can develop into a larger repair. Vibration and noise can often cause lath and plaster ceiling failure as can the installation of central heating. There is a small damp stain on the ceiling of the bedroom extension.

Internal walls	
Repair category	1
Notes	No significant defects evident.

Floors including sub-floors	
Repair category	2
Notes	There are some areas of uneven flooring.

Internal joinery and kitchen fittings	
Repair category	2
Notes	Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised Building Standards.

Chimney breasts and fireplaces	
Repair category	1
Notes	A multi fuel stove has been installed in the living room. It is assumed that the installation complies with the Building Standards. Flues should ideally be swept and tested on an annual basis. Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation. Disused chimneys should be capped and vented. If disused fireplaces are to be reopened further advice should be sought to ensure that the chimney flue is intact and suitable for use.

Internal decorations	
Repair category	1
Notes	There is some wear and tear to décor.

Cellars	
Repair category	-
Notes	

Electricity	
Repair category	2
Notes	The electrical installation appears dated Including some older sockets and switches. Further advice will be available from a NICEIC/SELECT registered electrician.

Gas	
Repair category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Water, plumbing an	d bathroom fittings
Repair category	2
Notes	There is a cracked wash hand basin.

Heating and hot wa	ter
Repair category	2
Notes	It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations. Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.

Drainage	
Repair category	1
Notes	No significant defects evident.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	1
Outside areas and boundaries	2
Ceilings	2
Internal walls	1
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes No X
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The property has been altered and extended. The alterations would appear to have been carried out some time ago. It is assumed that all necessary Local Authority and other consents have been obtained for alterations and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it has been assumed they meet the standards required by the Building Regulations or are exempt.

Estimated reinstatement cost for insurance purposes

£410,000 (Four hundred and ten thousand pounds). It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments

£170,000 (One Hundred and Seventy Thousand Pounds). The market presently demonstrates an imbalance between supply and demand generally across all price sectors. As a result competition between buyers is often leading to premium prices being paid that reflect the prevailing market conditions but may not be sustainable. The reported valuation figure reflects these market conditions but equally may not be sustainable if and when market conditions change.

Signed	Security Print Code [461797 = 9136]O Electronically signed
Report author	Michael G McDonald
Company name	DM Hall LLP
Address	27 High Street, Elgin, IV30 1EE
Date of report	1st July 2022

Mortgage Valuation Report



Property Address	
Address Seller's Name Date of Inspection	1 MARKET STREET, FORRES, IV36 1EF Mr Douglas and Mrs Brenda Urquhart 15th June 2022
Property Details	
Property Type	X House Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	X Detached Semi detached Mid terrace End terrace Back to back High rise block Low rise block Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, Yes X No silitary, police?
Flats/Maisonettes onl Approximate Year of	No. of units in block
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years Unexpired years
Accommodation	
Number of Rooms	2 Living room(s) 3 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)
•	cluding garages and outbuildings) 118 m² (Internal) 130 m² (External)
Residential Element ((greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage Available on site?	☐ Double garage☐ Parking space☐ Yes☐ NoXNo garage / garage space / parking space
Permanent outbuildin	gs:
No permanent outbu	uildings.

Mortgage Valuation Report

Construction							
Walls	Brick	X Stone	Concrete	Timber frame	Othe	r (specify in Gen	eral Remarks)
Roof	Tile	X Slate	Asphalt	Felt	Othe	r (specify in Gen	eral Remarks)
Special Risks							
Has the property s	suffered struc	tural moveme	ent?			X Yes	No
If Yes, is this rece	nt or progres	sive?				Yes	X No
Is there evidence, immediate vicinity		ason to antici	pate subsidence	, heave, landslip o	or flood in the	e Yes	X No
If Yes to any of the	e above, prov	vide details in	General Remark	S.			
Service Connec	tions						
Based on visual ir of the supply in Go			ces appear to be	non-mains, pleas	se comment	on the type a	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description o	of Central Hea	ating:					
Heating fuel: Gas	s Heating typ	e: Radiators					
Site							
Apparent legal iss	ues to be ver	ified by the co	onvevancer. Plea	ase provide a brie	f description	in General R	temarks.
Rights of way		es / access	_	amenities on separate		red service conr	
Ill-defined boundar	ies	Agricult	ural land included wi			er (specify in Ge	
Location							
Residential suburb	X Re	sidential within to	wn / city Mixe	ed residential / comme	rcial Mai	nly commercial	
Commuter village	Re	mote village	Isola	ated rural property	Oth	er (specify in Ge	neral Remarks)
Planning Issues	\$						
Has the property b	oeen extende	d / converted	/ altered?	Yes X No			
If Yes provide deta	ails in Genera	al Remarks.					
Roads							
Made up road	Unmade roa	d Partly	completed new road	Pedestrian a	ccess only	X Adopted	Unadopted

Mortgage Valuation Report

General Remarks
The property was generally found to be in fair order having regard to its age and type. Whilst some items of typical and ongoing maintenance issues are to be anticipated, these may be attended to during the course of routine works. The property forms part of an established residential area in the town of Forres. The surrounding properties in the immediate vicinity are generally of a differing age and style. A range of typical local amenities can be found nearby. The property has been altered and extended. The alterations would appear to have been carried out some time ago. It is assumed that all necessary Local Authority and other consents have been obtained for alterations and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it has been assumed they meet the standards required by the Building Regulations or are exempt.
Essential Repairs
There are some damp patches to lower wall surfaces. There is evidence of woodworm to roof timbers. A timber and damp specialist should be asked to inspect and carry out treatment works using guaranteed methods. Fetimated cost of escential repairs for the patch of

Mortgage Valuation Report

Comment on Mortgagea	bility	
The property generally for	ms suitable security for mortgage purposes.	
Valuations		
Market value in present cor Market value on completion Insurance reinstatement va (to include the cost of total in Is a reinspection necessary	of essential repairs lue rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 170,000 £ 410,000
Buy To Let Cases		
month Short Assured Tenai	ge of monthly rental income for the property assuming a letting on a 6 ncy basis? There there is a steady demand for rented accommodation of this type?	£ Yes No
Declaration		
Signed Surveyor's name	Security Print Code [461797 = 9136]O Electronically signed by:- Michael G McDonald	
Professional qualifications	MRICS	
Company name	DM Hall LLP	
Address	27 High Street, Elgin, IV30 1EE	
Telephone	01343 548501	
Fax	01343 548501	
Report date	1st July 2022	

PROPERTY QUESTIONNAIRE





Property address	1 MARKET STREET, FORRES, MORAY, IV36 1EF
Seller(s)	mr douglas urquhart
Completion date of property questionnaire	07 /06/2022

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer
 each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell
 your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? 1973
2.	Council tax
	Which Council Tax band is your property in? (Please circle)
	A B C D E F G H
3.	Parking
	What are the arrangements for parking at your property?
	(Please tick all that apply)
	• Garage
	Allocated parking space
	Driveway
	Shared parking
	On street
	Resident permit
	Metered parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

Yos / No	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?
	Alterations/additions/extensions
Yes / No	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?
	If you have answered yes, please describe below the changes which you have made:
	small bedroom downstairs
Yos / No	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:
	none available
Yes / No	Have you had replacement windows, doors, patio doors or double glazing installed in your property?
	If you have answered yes, please answer the three questions below:
Yes / No	(i) Were the replacements the same shape and type as the ones you replaced?
Yes / No	(ii) Did this work involve any changes to the window or door openings?
pproxima	(iii) Please describe the changes made to the windows, doors or patio doors (v dates when the work was completed):
	replacement windows
agent.	Please give any guarantees which you received for this work to your solicitor or

a. Is there a central heating system in your property? (Note: a patheating system is one which does not heat all the main rooms of the the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes / partial - what kind of central heating is the (Examples: gas-fired, solid fuel, electric storage heating, gas warm gas If you have answered yes, please answer the three guestions below	ne property - Partial nere? air).
(Examples: gas-fired, solid fuel, electric storage heating, gas warm gas	air).
	:
If you have answered use places answer the three guestions below	:
ii you nave answered yes, please answer the three questions below	
b. When was your central heating system or partial central hea installed?	ting system 2010
c. Do you have a maintenance contract for the central heating system	? Yes / No
If you have answered yes, please give details of the company wit have a maintenance contract:	h which you
d. When was your maintenance agreement last renewed? (Please provide the month and year).	
8. Energy Performance Certificate	
Does your property have an Energy Performance Certificate which 10 years old?	is less than Yes / No
9. Issues that may have affected your property	
a. Has there been any storm, flood, fire or other structural damproperty while you have owned it?	age to your Yes / No
If you have answered yes, is the damage the subject of any insurance claim?	outstanding Yes / No
b. Are you aware of the existence of asbestos in your property?	Yos / No
If you have answered yes, please give details:	

Plea	ase tick which services are plier:	connected to	your property and give details	of the
	Services	Connected	Supplier	
	Gas / liquid petroleum gas	✓	scottish gas	
	Water mains / private water supply	✓	council	
	Electricity	✓	scottish electric	
	Mains drainage	✓	council	
	Telephone	✓	bt	
	Cable TV / satellite	✓	sky	
	Broadband	✓	bt	
	ou have answered yes, please o you have appropriate cons			Yes / Ne Don't kno
` '	Do you have a maintenance cou have answered yes, please a maintenance contract:	-	septic tank? the company with which you	¥es / No

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	Yes / No / Don't Know
	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	Yes / No / Not applicable
	If you have answered yes, please give details:	
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes / No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	Yes / Ne
	If you have answered yes, please give details:	
	rubber roof on small bedroom 25yr guarantee right to enter neighbours property for one side house maintenance	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	Yes / No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	Yes / No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	Yes / No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	

b.	Is there a common buildings insurance policy?	Yos / No /
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / No / Den't Knew
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes / No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yos / No
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for an	y of the	following	:			
(i)	Electrical work	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(ii)	Roofing	Ne	Yes	Don't know	With title doods	Lost	Cannot Answer*
(iii)	Central heating	No	Yos	Don't know	With title deeds	Lost	Cannot Answer*
(iv)	NHBC	No	Yos	Don't know	With title deeds	Lost	Cannot Answer*
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	¥os	Don't know	With title doods	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela	ls', pleas te(s):	e give de	etails of t	he work		
	yes with title deeds for rubber roof						
c.	Are there any outstanding claims under any o	of the gua	arantees	listed abo	ve?	Yes	·/ No
	If you have answered yes, please give details	:					
15.	Boundaries						
	So far as you are aware, has any boundary o last 10 years?		operty be	een move	ed in the		/ No / t-know
	If you have answered yes, please give details	:					

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Den't know
b.	that affects your property in some other way?	Yes / No / Don't know
C.	that requires you to do any maintenance, repairs or improvements to your property?	Yes / No / Den't knew
	If you have answered yes to any of a-c above, please give the notices to your so agent, including any notices which arrive at any time before the date of entry of t your property.	olicitor or estate he purchaser of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):			
·			
Date:			

DM Hall Offices

Aberdeen 01224 594172 Galashiels 01896 752009 Livingston 01506 490404

Ayr

01292 286974

Glasgow (North) 0141 332 8615

Musselburgh 0131 665 6782

Cumbernauld

01236 618900

Glasgow (South)

0141 636 4141

01631 564225

Cupar

01334 844826

Hamilton

01698 284939

Paisley

Oban

0141 887 7700

Dumfries

01387 254318

Inverness

01463 241077

Perth

01738 562100

Dundee

01382 873100

Inverurie

01467 624393

Peterhead

01779 470220

Dunfermline

01383 621262

Irvine

01294 311070

Stirling

01786 475785

Edinburgh

0131 477 6000

Kirkcaldy

01592 598200

Elgin

01343 548501

DMHALL.CO.UK









01324 628321