# HOME REPORT

LITTLECOTE CHATTAN DRIVE

NAIRN IV12 4QR



# ENERGY PERFORMANCE CERTIFICATE





### **Energy Performance Certificate (EPC)**

# Scotland

Dwellings

#### LITTLECOTE, CHATTAN DRIVE, NAIRN, IV12 4QR

Dwelling type:	Detached house
Date of assessment:	09 July 2021
Date of certificate:	14 July 2021
Total floor area:	122 m <sup>2</sup>
Primary Energy Indicator:	871 kWh/m <sup>2</sup> /year


Reference number: Type of assessment: Approved Organisation: Main heating and fuel: 7319-6323-3200-0471-5202 RdSAP, existing dwelling Elmhurst Electric storage heaters

#### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£11,406	See your recommendations
Over 3 years you could save*	£6,021	report for more information

<sup>\*</sup> based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

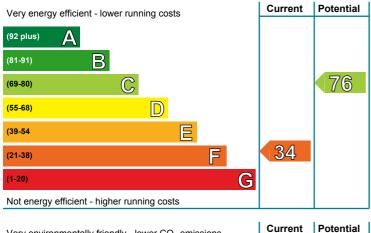

#### Very environmentally friendly - lower CO<sub>2</sub> emissions (92 plus) B (81-91) (69-80) (55-68) D 53 (39-54 (21-38) F 17 (1-20) G Not environmentally friendly - higher CO<sub>2</sub> emissions

#### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band F (34)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$  emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band G (17)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£100 - £350	£1221.00
2 Cavity wall insulation	£500 - £1,500	£909.00
3 Floor insulation (suspended floor)	£800 - £1,200	£1386.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282. THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 25 mm loft insulation Roof room(s), insulated (assumed)	★★☆☆☆ ★★★★☆	★★☆☆☆ ★★★★☆
Floor	Suspended, no insulation (assumed)	—	_
Windows	Fully double glazed	<b>★★★☆☆</b>	★★★☆☆
Main heating	Electric storage heaters	<b>★★★</b> ☆☆	****
Main heating controls	Manual charge control	★★☆☆☆	*****
Secondary heating	Room heaters, electric	—	_
Hot water	Electric immersion, off-peak	<b>★★★</b> ☆☆	★★☆☆☆
Lighting	Low energy lighting in all fixed outlets	****	****

#### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

#### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

#### The calculated emissions for your home are 147 kg CO<sub>2</sub>/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 18 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 10.0 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated	enerav o	costs fo	or this h	ome
				•••••

Estimated energy costs for this nome			
	Current energy costs	Potential energy costs	Potential future savings
Heating	£10,437 over 3 years	£4,680 over 3 years	
Hot water	£678 over 3 years	£414 over 3 years	You could
Lighting	£291 over 3 years	£291 over 3 years	save £6,021
Tota	ls £11,406	£5,385	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Do		Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	indicative cost	per year	Energy	Environment
1	Increase loft insulation to 270 mm	£100 - £350	£407	E 40	F 22
2	Cavity wall insulation	£500 - £1,500	£303	E 45	F 26
3	Floor insulation (suspended floor)	£800 - £1,200	£462	E 53	F 32
4	High heat retention storage heaters	£2,400 - £3,600	£640	D 64	E 41
5	Solar water heating	£4,000 - £6,000	£76	D 66	E 44
6	Replacement glazing units	£1,000 - £1,400	£118	D 68	E 47
7	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£318	C 76	E 53

#### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation
- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

#### Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

#### 2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

#### 3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

#### 4 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

#### 5 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### 6 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

#### 7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

#### Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	31,896	(3,732)	(2,781)	N/A
Water heating (kWh per year)	2,387			

#### Addendum

#### About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Colin MacGregor
Assessor membership number:	EES/007937
Company name/trading name:	D M Hall Chartered Su
Address:	Ardross House 3 Ardro
	Inverness
	IV3 5NQ
Phone number:	01463241077
Email address:	enquiries@dmball.co.u

Email address: Related party disclosure:

urveyors LLP oss Terrace enquiries@dmhall.co.uk No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.





# SINGLE SURVEY





### survey report on:

Property address	LITTLECOTE CHATTAN DRIVE NAIRN IV12 4QR
------------------	--

Customer
----------

Customer address	Littlecote Chattan Drive Nairn IV12 4QR
------------------	--

Prepared by DM Hall LLP
-------------------------

Date of inspection	9th July 2021
--------------------	---------------



### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### **1.2 THE REPORT**

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report<sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

LITTLECOTE, CHATTAN DRIVE, NAIRN, IV12 4QR 9th July 2021 HP676244/SQ

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

#### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

#### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### **1.10 DEFINITIONS**

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

### **PART 2 - DESCRIPTION OF THE REPORT**

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1. <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

#### WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

#### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	One and a half storey detached villa.
F	GROUND FLOOR:- Entrance Vestibule, Kitchen, Living Room/Dining Room, Three Bedrooms, Bathroom with WC and Shower Room with WC. FIRST FLOOR:- Bedroom.

Gross internal floor area (m²)	125 square metres approximately.

Neighbourhood and location	The property is situated in an established residential area close to Nairn town centre where local amenities and facilities can be
	found.

Age	Circa 1966.

Weather	Dry and overcast.

Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	The chimney stack is of pointed reconstituted stonework construction having metal flashings.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.

If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
The roof is of pitched design clad with slates having tiled ridging. Valleys are lined with metal. The dormer window projection is of a low pitched design clad with copper.
Access to the roof timbers is available via two hatches into the eaves.
The roof is timber framed with timber sarking.
The roof space has been partly floored.
Glasswool insulation has been laid to ceiling joists.

Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Gutters and downpipes are of round and half round design and are formed in cast iron.

Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The walls are of 355mm rendered cavity concrete blockwork construction. There is pointed reconstituted stonework detailing and timber clad detailing.

Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows are of double glazed uPVC design.
	The front access door is of uPVC design with a double glazed insert. There are double glazed uPVC framed patio doors.
	Soffits and fascias are formed in timber.

External decorations	Visually inspected.
	External joinery is paint finished.

Conservatories / porches	Visually inspected.
	The entrance porch is of single leaf rendered concrete blockwork construction contained under a pitched and tiled roof. There is an open integral porch contained under a pitched and slated roof.

Communal areas	Not applicable.
Garages and permanent outbuildings	Visually inspected.
	There is a detached double car garage of timber frame construction contained under a pitched roof clad with felt. There is a timber framed single car port.

Outside areas and boundaries	Visually inspected.
	The garden is mainly laid with chips and contains flower beds and patio areas.
	The right hand boundary is defined by timber post and panel fencing and timber post and wire fencing. The remainder of boundaries are defined by stone and concrete blockwork walls.

Ceilings	Visually inspected from floor level.
	Ceilings have been lined with plasterboard.

Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls and partitions are of timber stud lined with plasterboard.


Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Flooring is of suspended timber design in the main house. Flooring in the entrance porch is of solid concrete design.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Interior doors are of flush timber panel design. Some internal doors have glazed inserts.
	The kitchen has a range of floor and wall mounted units.
	The staircase is of timber design.

Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	The living room fireplace has an electric insert. The back boiler to the fireplace has been disconnected from the hot water tank.
Internal decorations	Visually inspected.
	Wall and ceiling surfaces are finished in a mixture of paint and paper.
Cellars	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply with the meters and fuses located in the entrance porch cupboard.
Gas	Not applicable.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains water supply. There are two three piece suites, one comprising shower cubicle with WC and wash hand basin with the second comprising bath, WC and wash hand basin.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property is heated by means of electric storage and panel heaters distributed throughout.
	There is a prelagged copper hot water tank situated in the hall cupboard. This has an electric immersion heater.

Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage is connected to the main public sewer.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	A fire and smoke alarm system has been installed.
Any additional limits to inspection	Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.
	I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.
	The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.
	Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.
	The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring.
	In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.
	Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.
	My inspection of the roof covering was restricted from ground level and some parts were not visible. Viewing of the roof structure was restricted from within the site boundaries and from the public road.
	I was not able to inspect the sub-floor area.
	Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.
	The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.
	Where repairs are required at height compliance with Health and

Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

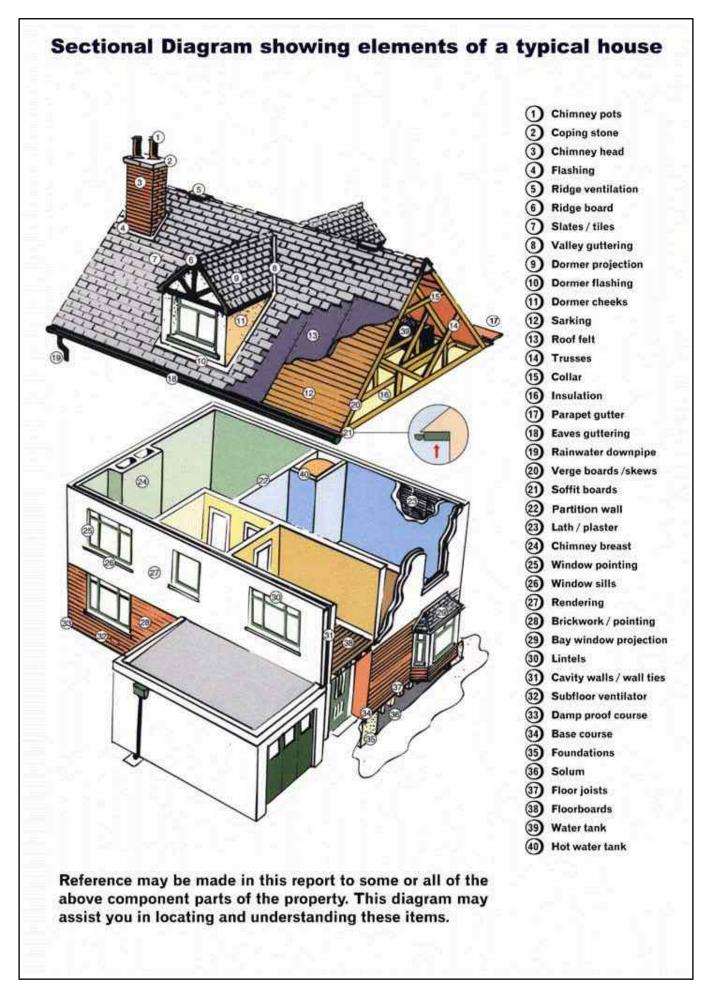

#### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, rot and infestation	
Repair category	2
Notes	<ul> <li>There is evidence of wood boring insect infestation. This can be treated by a timber/specialist contractor.</li> <li>There is decay to lower timber clad detailing of the front elevation. A joinery contractor will be able to advise further.</li> <li>There is evidence of condensation in the rear left hand cupboard of the first flor bedroom. This may be alleviated by a proper balance of heating and ventilation. This should be monitored. Further advice can be obtained from a specialist contractor.</li> </ul>

Chimney stacks	
Repair category	1
Notes	No significant defects evident.

Roofing including roof space	
Repair category	2
Notes	<ul><li>There is missing ridge pointing. A contractor will be able to advise on the necessary repairs.</li><li>There is evidence of wood boring insect infestation. Please see comments under Dampness, Rot &amp; Infestation.</li></ul>
LITTLECOTE, CHATTAN DRIV NAIRN. IV12 4QR	

	There are wasp bykes in the roof space.
Rainwater fittings	
Repair category	1
Notes	No significant defects evident.

Main walls	
Repair category	2
Notes	There is decay to lower timber clad detailing as previously mentioned in the Dampness, Rot and Infestation section. There is cracking to render.

Windows, external doors and joinery	
Repair category	1
Notes	The window units are of an older type. The seals to older double glazed units often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions.

External decorations	
Repair category	1
Notes	There is weathering to external timbers.

Conservatories/porches	
Repair category	1
Notes	No significant defects evident.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	2
Notes	The electrical installation is dated with wire fuses noted. Further advice will be available from a NICEIC/SELECT registered electrician.

Outside areas and boundaries	
Repair category	1
Notes	There are decayed timber posts.
	There is cracking to walling.

Ceilings	
Repair category	1
Notes	No significant defects evident.

Internal walls	
Repair category	1
Notes	No significant defects evident.

Floors including sub-floors	
Repair category	1
Notes	No significant defects evident. It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings	
Repair category	2
Notes	Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised Building Standards.

Chimney breasts and fireplaces	
Repair category	1
Notes	Flues should ideally be swept and tested on an annual basis.

Internal decorations	
Repair category	1
Notes	Decorative finishes are worn.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	The electrical installation is dated with wire fuses and older sockets and switches noted. Further advice will be available from a NICEIC/SELECT registered electrician.

Gas	
Repair category	-
Notes	Not applicable.

<b>F</b> • Water, plumbing and bathroom fittings	
Repair category	1
Notes	No significant defects evident.

Heating and hot water	
Repair category	1
Notes	It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.

Drainage	
Repair category	1
Notes	No significant defects evident.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	1
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	-
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

#### **Category 3**

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

#### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

#### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. Accessibility information

#### Guidance notes on accessibility information

#### Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

#### Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and First
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

#### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

The attic floor was converted into accommodation and other internal alterations completed at ground level in circa 1991. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

#### Estimated reinstatement cost for insurance purposes

£215,000 (TWO HUNDRED AND FIFTEEN THOUSAND POUNDS).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

#### Valuation and market comments

£245,000 (TWO HUNDRED AND FORTY FIVE THOUSAND POUNDS).

The property market over the past twelve months has been somewhat buoyant with a number of houses selling in a short period of time.

Signed	Security Print Code [509679 = 5427 ] Electronically signed
Report author	Colin MacGregor
Company name	DM Hall LLP
Address	Ardross House, 3 Ardross Terrace, Inverness, IV3 5NQ
Date of report	15th July 2021

#### Mortgage Valuation Report



Property Address	
Address Seller's Name Date of Inspection	LITTLECOTE, CHATTAN DRIVE, NAIRN, IV12 4QR Ms Isobel Drummond 9th July 2021
Property Details	
Property Type	X House       Bungalow       Purpose built maisonette       Converted maisonette         Purpose built flat       Converted flat       Tenement flat       Flat over non-residential use         Other (specify in General Remarks)
Property Style	X       Detached       Semi detached       Mid terrace       End terrace         Back to back       High rise block       Low rise block       Other (specify in General Remarks)
Does the surveyor bel e.g. local authority, mi	lieve that the property was built for the public sector, Yes X No ilitary, police?
Flats/Maisonettes only Approximate Year of 0	No. of units in block
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	1       Living room(s)       4       Bedroom(s)       1       Kitchen(s)         2       Bathroom(s)       2       WC(s)       0       Other (Specify in General remarks)         aluding generates and outbuildings)       105       a (f) (g)       a (f) (g)       a (f) (g)
	cluding garages and outbuildings) 125 m² (Internal) m² (External) /greater than 40%) X Yes No
Garage / Parking / 0	Outbuildings
Single garage Available on site?	X       Double garage       Parking space       No garage / garage space / parking space         X       Yes       No
Permanent outbuilding	gs:
Single timber car por	rt.

#### Mortgage Valuation Report

Construction							
Walls	X Brick	Stone	Concrete	Timber frame	Othe	r (specify in Gen	eral Remarks)
Roof	Tile	X Slate	Asphalt	Felt	Othe	r (specify in Gen	eral Remarks)
Special Risks							
Has the property s	suffered stru	ctural movem	ent?			Yes	XNo
If Yes, is this rece	nt or progres	ssive?				Yes	No
Is there evidence, immediate vicinity	•	eason to antic	cipate subsidence	e, heave, landslip	or flood in the	e Yes	X No
If Yes to any of the	e above, pro	vide details ir	n General Remar	<b>(</b> S.			
Service Connec	tions						
Based on visual ir of the supply in G			vices appear to b	e non-mains, plea	se comment	on the type a	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	Mains	Private	X None
Central Heating	X Yes	Partial	None				
Brief description c	of Central He	ating:					
Electric storage	and panel he	eaters.					
Site							
	ues to be ve	rified by the	opyoyapcor Pla	aso provido a bric		in Conoral R	omarks
Apparent legal iss	_	ives / access		ase provide a brie	_	red service conn	
Ill-defined boundar			Iltural land included w			er (specify in Ge	
Location							
Residential suburb		esidential within	town / city Mix	ed residential / comme	ercial Mair	nly commercial	
Commuter village	_	emote village		ated rural property		er (specify in Ge	neral Remarks)
Planning Issues	6						
Has the property I	been extend	ed / converted	d / altered? X	Yes 🗌 No			
If Yes provide det	ails in Gener	al Remarks.					
Roads							
X Made up road	Unmade ro	ad Parti	y completed new road	e Pedestrian a	access only	Adopted	Unadopted

#### General Remarks

The property was found to be in acceptable condition for its with age and type. Some works of repair and maintenance were noted.

There is evidence of woodworm infestation to attic timbers which should be treated to a guaranteed standard by a timber specialist.

The attic floor was converted into accommodation and other internal alterations completed at ground level in circa 1991. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

#### **Essential Repairs**

None.			
Estimated cost of essential repairs £	Retention recommended?	X No	Amount £

#### Mortgage Valuation Report

#### **Comment on Mortgageability**

The property will form suitable security for mortgage purposes at the figure of value outlined below.	
Valuations	
Market value in present condition	£ 245,000
Market value on completion of essential repairs	£
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 215,000
Is a reinspection necessary?	Yes X No
Buy To Let Cases	
What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£ N/A
Is the property in an area where there is a steady demand for rented accommodation of this type?	Yes No

Declaration	
Signed	Security Print Code [509679 = 5427 ] Electronically signed by:-
Surveyor's name	Colin MacGregor
Professional qualifications	BSc (Hons) MRICS
Company name	DM Hall LLP
Address	Ardross House, 3 Ardross Terrace, Inverness, IV3 5NQ
Telephone	01463 241077
Fax	01463 233627
Report date	15th July 2021

# **PROPERTY QUESTIONNAIRE**





Property Address
LITTLECOTE
CHATTAN DRIVE
NAIRN
IVIZ 4QR

Seller(s) SOBEL MAE GORDON DRUMMOND				
Completion date of Property Questionnaire	12-7-2021			

#### Note for sellers

- Please complete this form carefully. It is important your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell you solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

	1.	Length of Ownership				
		How long have you owned th Since Febru Owned solely by -	e property? Jointly with John Dumand, husband, any 1991 until my husband's decease 30-1-20, me suice 30-1-20			
	2.	Council Tax				
		Which Council Tax band is ye	our property in?			
		A B C D H F G H				
	3.	Parking				
		What are the arrangements f	or parking at your property?			
		(Please tick all that apply)				
		Garage	M			
		Allocated parking space				
a	50	Driveway				
		On street				
		Resident Permit				
		Metered parking				
		Shared parking				
		Other (please specify)				

٠

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Please select
		No
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Please select
6.	Alterations/Additions/Extensions	
а.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example provision of an extra bath/shower room, toilet or bedroom)? If you have answered yes, please describe below the changes which you have made: Extra shower fixed startage	Please select ソモS
	Entrance changed. Double garage built -	
	Entrance changed. Double garage built - all completed 1991	
	(ii) Did you obtain planning permission; building warrant, completion certificate and other consents for this work?	Please select イモら
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.	s.
b.	Have you had replacement windows, doors, patio doors or double-glazing installed in your property? If you have answered yes, please answer the three questions below:	Please select YES
-	(i) Were the replacements the same shape and type as the ones you replaced?	Please select 7 ≇ S
-	(ii) Did this work involve any changes to the window or door openings?	Please select
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):	
7.	Central heating	

	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Please select
	If you have answered yes or partial - what kind of central heating is there?	NES
	ELECTRIC STORAGE	
	(examples: gas-fired, solid fuel, electric storage heating, gas-warm air).	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed?	1991
	(ii) Do you have a maintenance contract for the central heating system? $NO$	Please select
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
0.	Does your property have an Energy Performance Certificate, which is less than 10 years old?	Please select
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Please select
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Please select
b.	Are you aware of the existence of asbestos in your property?	Please select
	If you have answered yes, please give details:	
	¥	8
10.	Services	

a.	Please tick which services are connected	I to your property and give details of the	
	supplier:		
	Services	Connected Supplier	
	Gas or liquid petroleum gas		
	Water mains or private water supply	SCOTTISH WATER	
	Electricity	V SSE	
	Mains drainage	D SCOTFISH WATER	
	Telephone	7 B.T.	
	Cable TV or satellite		
-	Broadband		
b.	Is there a septic tank system at your p	roperty?	Please select N ଦ
	If you have answered yes, please answe	V.V1	
	(i) Do you have appropriate consents for	the discharge from your septic tank?	Please select
	(ii) Do you have a maintenance contract If you have answered yes, please give de	Please select	
	have a maintenance contract:		

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	Please select
	<u>in you nave answered yes</u> , please give details.	
b.	Is there a responsibility to contribute to repair and maintenance of the roof,	Please select
	common stairwell or other common areas?	1
		NO
	If you have answered yes, please give details:	
C.	Has there been any major repair or replacement of any part of the roof during	Please select
	the time you have owned the property?	NO
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	Please select Not REQUIRED
	If you have answered yes, please give details:	1 EQUIVED
e.	As far as you are aware, do any of your neighbours have the right to walk over	Please select
	your property, for example to put out their rubbish bin or to maintain their boundaries?	NOF
		REQUIRED
	If you have answered yes, please give details:	
	3	

	property questionnaire	
f.	As far as you are aware, is there a public right of way across any part of your property (public right of way is a way over privately-owned)?	Please select
	If you have answered yes, please give details:	NIL
	2	
12.	Charges associated with your property	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	Please select
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	NIL
b.	Is there a common buildings insurance policy?	Please select
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Please select
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
		NIL
		0

13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	Please select
b.	As far as you were aware, has any preventative work for dry rot, wet rot, or damp, ever been carried out to your property? <u>If you have answered yes</u> , please give details:	Please select
С.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	Please select

14.	Guarante	es			
a.	Are there any guarantees or warranties for any of the following:				
	(i)	Electrical work	Please select		
	(ii)	Roofing	Please select		
	(iii)	Central heating	Please select		
	(iv)	National House Building Council (NHBC)	Please select		
	(v)	Damp course	Please select		
	(vi)	Any other work or installations (for example, cavity wall insulation, underpinning, indemnity policy)	Please select		
			NIL		
b.		e answered yes or 'with title deeds', please give details of the work or ns to which the guarantee(s) relate(s):			
C.	Are there	any outstanding claims under any of the guarantees listed above?	Please select		
	If you hav	<u>ve answered yes</u> , please give details:	NIC		
	÷				
15.	Boundar	ies			
		you are aware, has any boundary of your property been moved in the	Please select		
	If you hav	<u>/e answered yes</u> , please give details:	NIL		

ł

16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Please select
b.	that affects your property in some other way?	Please select
с.	that requires you to do any maintenance, repairs or improvements to your property?	Please select
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	NIL

#### Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

# For security reasons the signature(s) have been obscured.

Signature(s):

l

md

12 - 7 - 2021

Date:

## **DM Hall Offices**

Aberdeen 01224 594172

Cumbernauld

01236 618900

01334 844826

01387 254318

01382 873100

Ayr

Cupar

**Dumfries** 

Dundee

Galashiels 01896 752009

Glasgow (North) 01292 286974 0141 332 8615

> Glasgow (South) 0141 636 4141

> > Hamilton 01698 284939

Inverness 01463 241077

Inverurie 01467 624393

Irvine 01294 311070

**Kirkcaldy** 01592 598200 Livingston 01506 490404

Musselburgh 0131 665 6782

Oban 01631 564225

Paisley 0141 887 7700

Perth 01738 562100

Peterhead 01779 470220

Stirling 01786 475785



Dunfermline 01383 621262

Edinburgh 0131 477 6000

Elgin 01343 548501

Falkirk 01324 628321